


CT-RH-T Room Temperature & Humitdity Transmitter

Temperature & Humidity Transmitter

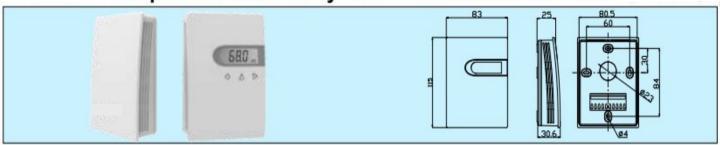

Applications & Features

- Apply for indoor air T/RH measurement with good performance digital sensor & circuit. The sensor is 100% field changeable without re-calibration
- Good long term stability, reliability and fast response
- · State of art housing. All electrical terminals are on the inside bottom, avoid any possible destroy to PCB when wiring
- Multiple outputs optional, over voltage and reverse polarity protection, and good anti-interference capability
- LCD & function keys can set parameters and calibrate output, so the product can be a stand alone controller

Specifications

Relative Humidity

Sensor: Digital polymer Range: 0~100%RH

Output: 4~20mA (2 wires), 0~10VDC (3 wires), RS485/Modbus

Accuracy: 2, 3%RH (25 °C, 20~80%RH)

Hysteresis: <±1%RH

Response time: <10s (25 ℃, in slow air)

Drift: <±0.5%RH/year

Temperature

Sensor: Digital, RTD or thermistor, see models

Range: 0~50 ℃ Output: see Models

Accuracy: transmitter: <±0.4 ℃(0.3 ℃) @ 5~60 ℃, see models Power: Current: 18.5~35VDC (R_L=500Ω); 8.5~35VDC (R_L=0Ω)

Voltage: 16~28VAC/ 16~35VDC Output Load: ≤500Ω (current), ≥2KΩ (voltage)

Relay output: 2×SPST, 3A/30VDC, 3A/250VAC

Display and Keys: 4 bits LCD, with unit indication, backlight (4-20mA N/A), 3 keys, see details on LCD & Keys operation Display Resolution: 0.1 ℃, 0.1%RH

Temp. Limit: -20~70 °C, 5~95%RH (Non cond.)

Housing: fire retardant PC(UL94V-0), Protection: IP30

Weight: 110g Approval: CE

Models

Model	CT-RI	1-1	[Room T/RH transmitter
RH Accuracy		2			(C. 3			±2%RH(0.3 ℃) ±3%RH(0.4 ℃)
RH Output			1 2 8		22 3			0~10VDC(3 wires) 4~20mA(2 wires) RS485/Modbus
Temp. Output				0 1 2 3 4 5 6 7 8 9 A				No 0~10VDC(3 wires) 4~20mA(2 wires) PT1000, ±0.2 C@25 C PT100, ±0.2 C@25 C NTC20K, ±0.2 C@25 C Ni 1000, ±0.5 C@25 C NTC10K-II, 0.2 C@25 C RS485/Modbus NTC10K-II, 0.3 C@25 C NTC10K-A, 0.3 C@25 C
Temp. Range				2	0 1 7		9	No 0~50 ℃ others
Relay				i it	8 8	0		No 2×SPST (4-20mA N/A)
LCD& Keys					8-6		0 1 2	No LCD LCD & Keys

- 1. Current output products are powered on RH circuit, so RH circuit must be powered.
- 2. When temp. output is 1 or 2, the range 1-7 is applicable. Otherwise, always use 0.
- See resistance table on page 1 of this catalog.